



UR FOG

SECURITY FOGGING SYSTEMS

INSTALLATION AND USE MANUAL



FAST PUMP PRO PLUS

FAST **250** PUMP PRO PLUS
FAST **500** PUMP PRO PLUS

ENGLISH MANUAL

WARNING!

All UR FOG fogging systems should only be used with UR FOG-branded fluids.
It is strictly forbidden to use any fluid not previously authorized in writing by UR FOG srl.

SUMMARY

01	Package contents	page 2
02	Introduction of the product	page 3
03	Conditions of use and warnings	page 3
04	Installations tips for fogging systems	page 4
05	Technical specifications	page 5
06	How to activate the system	page 6
07	Mains power and power supply connections	page 7
08	Description of input and output connections	page 8
09	Connection examples	page 10
10	Shooting time settings and fog flow direction	page 14
11	Nozzle tamper	page 15
12	Installation, exchange and reset	page 16
13	Front LEDS Meaning	page 17
14	Maintenance	page 18
15	Reset from fault conditions	page 19
16	Defects and possible solution	page 20
17	Warranty	page 22
18	Maintenance	page 23

The conditions of use will be automatically accepted by breaking the security labels on the product.

01 PACKAGE CONTENT

Inside the package you will find:

- 1. The FAST 250 or 500 PUMP PRO PLUS unit
- 2. One 1000 ml bag
- 3. A window sticker to indicate the device presence
- 4. Installation and use manual

02 INTRODUCTION OF THE PRODUCT

Thank you for purchasing UR Fog product.

The great patented technological innovations such as the liquid injection system, the fact with the heating system, all of them make the FAST fog generators the best fog devices with the best performance in the security market.

- **Simple:** machine easy to install and able to be integrated to any existing alarm system.

The unit is certified to be fully compliant with **CENELEC EN 50131-8:2019** rules.

Certificate of Conformity: **Applica 30422-01-20-INT**.

03 CONDITIONS OF USE AND WARNINGS

The fog generated by UR Fog does not create particular problems or injuries for a human being for a short stay in a fogged room if the system is used according to the manufacturer's recommendations.

Generated fog is certified as safe for people and animals from an authorized international certification company and is proved that it does not leave any residual.

UR Fog systems are certified respecting European laws and regulations. Any certifications required in specific countries are a responsibility of the distributor of that specific country.

The documents related to certifications can be requested by mail to **support@urfog.com**.

It is not guaranteed by the manufacturer the use of UR Fog system in the presence of objects that may be damaged anyway by the contact with substances based on glycol, water and alcohol. Any employee or worker that may be exposed to fog must be warned in advance and must be checked for any allergy to the substances listed above. At the date of printing of this manual it has never been pointed out any problem related to any allergy.

UR Fog is in no way responsible for any damage or condition of use that has not been required and specifically approved by any specific written request prior to the installation of its products.

For fog fluid please refer to UR Fog fluid safety data sheet published on the website and carefully read it at **www.urfog.com**.

Contact a doctor if for any reason you swallow fog fluid or if after contact with eyes or skin you have any kind of reaction, and in any case wash it immediately with water and soap. Do never stay for a long time in a room filled with fog.

Do not use charged cylinders that are not the ones suggested by UR Fog and never try to recharge them, they are made for a single use. Follow your national rules for the dispose of empty cylinders.

Keep UR Fog cylinders out of reach of babies and animals. The nozzle may be hot and touching it may cause burns.

Do not look directly into the nozzle.

Never use UR Fog products for any purpose that is not related to protection from thief or robbery (the choice of the conditions of use in case of robbery will be suggested by your security consultant).

Never use different fog fluids or add any other substance into the cylinders.

Do not use or keep charged UR Fog machines in vehicles and do never transport UR Fog before 24 hours since it has been shut off. During transport it must be not armed.

Please observe the following instructions for installing UR Fog:

1. This appliance is not intended for use by person (including children) with reduced physical, sensory or mental capabilities, or lack of experience and knowledge, unless they have been given supervision or instruction concerning use of the appliance by a person responsible for their safety.
2. Children should be supervised to ensure that they do not play with this appliance.
3. The machine must be installed avoiding to obstruct escape routes.
4. Verify the fog does not limit the visibility near: stairs, landings, moving objects that may cause: falls down, injuries or any damage to persons.
5. Do not look directly into the nozzle. Do not add any other substance into the bags.
6. The nozzle may reach high temperatures, touch it may cause burns.
7. When UR Fog produces fog avoid staying closer than 1 meter from the machine.
8. When UR Fog is armed avoid staying closer than 50 cm from the nozzle.
9. Before testing UR Fog, remember to report it in advance to the firefighters in your area to avoid false alarms.
10. Remember to put warning labels about the presence of UR Fog on the windows.
11. Report its installation to the firefighters in your area and eventually to other institutions if needed.
12. It is necessary to add an external switch to separate the fog generator from the alarm system and it should be activated before the maintenance to avoid that input tests, for example, can activate the fog generator.
13. Never direct the fog jet towards an object or a wall less than 2 meters away and if possible increase the suggested minimum distance. Thanks to the power of the jet, UR Fog reaches and exceeds more than 10 meters away in the first 3 seconds from the point where the machine is installed.
14. Setting the shooting time interval between the minimum and maximum shown in the shooting table, avoid "overshooting" even if the produced fog is dry and generally doesn't leave residue.
A shot that goes far beyond the recommended seconds can create a residue problems in the room.
16. UR Fog continues to be effective for up to 2 hours and 30 minutes without 220V or 110V main power thanks to the insulation system which maintains the temperature in the heating system.
16. Install at an height of about 2,5 meters not to let it be reached, avoiding possible tampering.
17. Install with a maximum inclination of 20°.
18. Do not move the machine when it is still hot.
19. The main body of UR Fog, which has the heating system enclosed inside a metal frame, should not be opened unless by specific and authorized service centers. Do not open and touch for any reason the insulation before 24 hours UR Fog has been shut off. The internal part may reach really high temperature.
20. Do not activate the UR Fog machine before the installation is completed.
21. Insert the cylinders as the last procedure and verify the anti-tampering function.
22. When the installation is finished, always test the system.
23. From the moment of UR Fog activation, at least one hour is necessary to reach the minimum temperature needed for the fog shooting.
24. Install UR Fog avoiding any obstacles in front of it which can prevent the spreading of the fog.
25. The external temperature of UR Fog can change from room temperature to 50 °C.
26. The tip of a stranded conductor should not be soft-soldered where the conductor is subjected to contact pressure.
27. The UR Fog machine should not be exposed to water spray or dripping.
28. Request to UR Fog or its distributors to take part in courses for installers to ensure the optimal installation of the equipment.
29. The content of the bags is mechanically predetermined and can be subject to variations +/- 10%

* Industrial standard as from other manufacturers	FAST 250 PUMP PRO PLUS	FAST 500 PUMP PRO PLUS
Weight without bag and battery	14,0 Kg	18,0 Kg
Max fog emission in a single shot	250 m³	500 m³
Total fog emission capacity	1300 m³	1500 m³
Fog bag capacity	1000 ml	1000 ml
Working time without mains power	about 2 hours	about 2 hours
Max power on heating system	300 W	300 W
Average power consumption during heating	270 W	270 W
Heating time	about 50 minutes	about 90 minutes
Average power consumption	37 W	42 W
Maximum current consumption at 12 V	4 A	4 A
Batteries type suggested	Pb 2 Ah 12V	Pb 2 Ah 12V
Door tamper	Screw to ground	Screw to ground



The “empty” signal does not mean only that the bag is empty, but also warns that the system has shot at least 100 seconds (PUMP 250) or 60 seconds (PUMP 500). For this reason is very important to make the “reset” only when you actually exchange the bag or you will lose the seconds counting.

WARNING:

- Loosened ferrule can cause dropping
- Do not disconnect the machine immediately after the shot
- Change the battery every two years
- Change the bag as soon as the “empty” signal appears
- The generator cannot be activated on a surface that does not allow air circulation from lower slots



It is always recommended to fix the fog generator to a wall even when it is placed on a flat surface. The optional bracket, mainly recommended for ceiling installation, can also simplify standard installation, by allowing to use back holes for the passage of cables. Remember to use a screw in the fixing hole placed in the bag compartment.

Always verify that the bracket or the support surface are suitable for the weight of the machine. It is suggested not to install the machine behind walls in a limited closed area without a specific ventilation, in order to prevent a possible overheating.

CAUTION: to avoid injuries please securely fix the fogging machine to the wall according to the installation instructions. In case of installation behind a wall, it is possible to request a nozzle extension of 7 cm.






After removing the machine from the package, unscrew the two screws that stop the right side panel and remove it. Remove tamper screw and shell screws from inside.

At this point it is possible to remove frontal shell and see electronic circuit, from here on called PCB.

To open the additional compartment in the lower part, it is necessary to remove bag compartment's door and take off the frontal shell, unscrew and remove the screws below.

The screw in **lower left** part of bag compartment's door is longer than the others and its removal activates the tamper output. After the screw has been positioned correctly, the machine emits 4 beeps and deactivate tamper output.

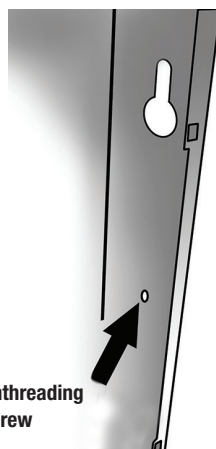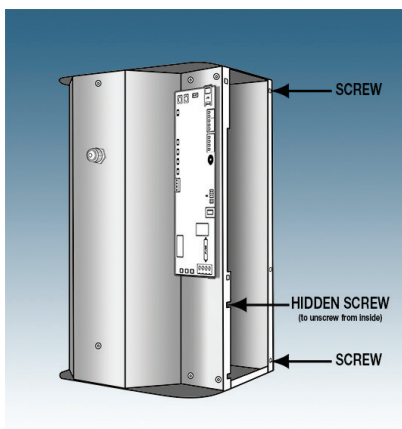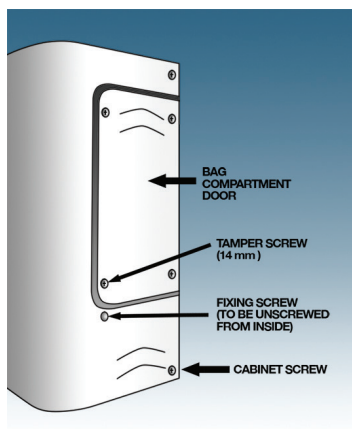

230V and 120V power source supplies energy only to the heating system. The electronic board and the bag's pump are supplied from the PSU or backup and batteries. The heating element is of 300W, at the very beginning power consumption is about 270W and in some minutes it goes down reaching average consumption is about 37W - 42W.





Do not use inverter or UPS if you are not sure that they generate a true sine wave, not a rebuilt one. Ask please to the UPS manufacturer the correspondance of such features before proceeding with the connection.

- The max current to be considered for the system is 3,15A
- The connection to the 230V and 120V electricity grid must be performed by a qualified technician.
- Connect the equipment to the electricity grid only after you have completed the installation.
- It is necessary to connect the ground terminal.
- The system must be connected to the mains trough on automatic switch (automatic switch, curie C, with $I_h = 10\text{ A}$ and $I_{dif} = 30\text{ mA}$,...) with breching capacity based on the assumed fault current of the fogging system in the sampling point.


PLEASE NOTE THAT, AS ALL POWERED EQUIPMENT FROM THE ELECTRICITY GRID REQUIRING INSTALLATION, IT IS SUBJECT TO COMPLIANCE WITH RULES OF THE COUNTRY IN WHICH IT IS INSTALLED
For section and types of wires, fuses, suitability of materials to installation sites etc.

IF YOU NEED TO REPLACE THE FUSE, USE ONLY FUSE WITH THE FOLLOWING SPECIFICATIONS:
CERAMIC BODY FILLED WITH QUARTZ, REF. STD. EN60127-2-3/DIN41660 3,15A (EXAMPLE OMEGA GT520231)

- The battery is necessary to use the system in a safe way.
The battery is recharged by power supply.
- The placing of the lead-acid battery 2 Ah 12 V is in the case under the heat exchanger.
- In order to accede to the battery case is necessary to remove the frontal cover and the 2 locking screws.

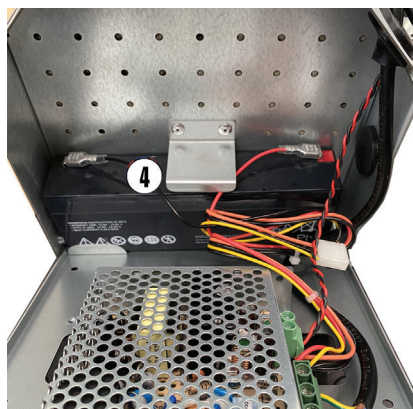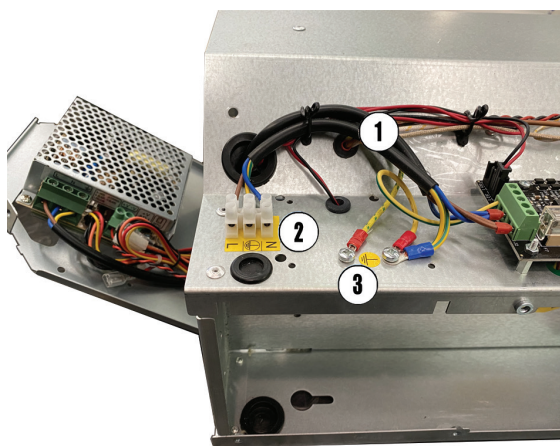

- 1** Power supply main connections
- 2** Mains power
- 3** Ground connection
- 4** Battery holder (battery not included)

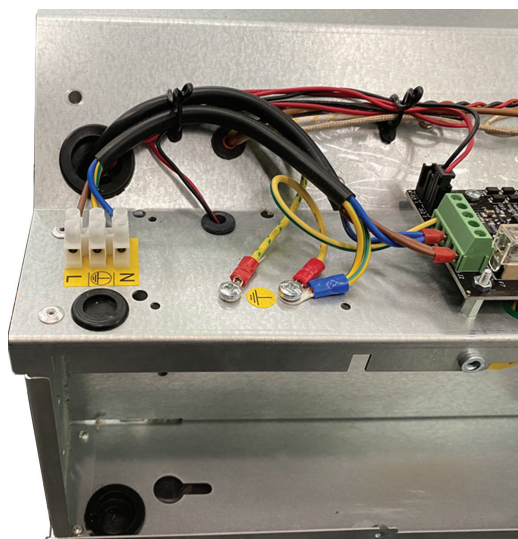


While connecting the machine to the mains power, it is recommended to never disconnect existing ground cable.

The fact of disconnecting or modifying existing cables voids the warranty and can cause troubles or accidents related to the temperature control.

Connect ground cable from the system to the screw on the metal sheet.

08 DESCRIPTION OF INPUT AND OUTPUT CONNECTIONS

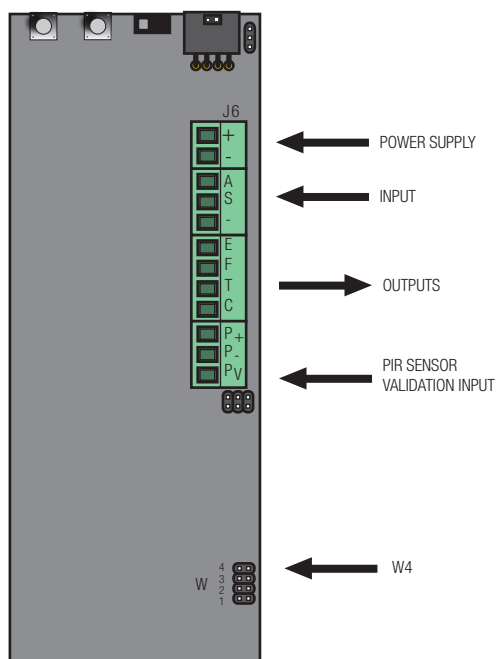

INPUTS

- +** Power supply input
- Power supply input
- ARM** Arming input
- SHOOT** Shooting input
- Negative

OUTPUTS

- EMPTY** Empty bag output
- FAULT** Fault output
- TAMPER** Tamper output
- CONFIRM** Shot confirmation output

PIR SENSOR VALIDATION INPUT

- P+** Positive power supply output
- P-** Negative power supply output / COM. PIR
- PV** N.C. PIR

INPUTS

+ 12V Power input

The power supply is connected to those inputs.

INPUT SIGNALS

A By connecting this input to positive, FAST PUMP PRO PLUS is armed, blue frontal LED is switched on and when the machine reaches proper temperature it means that it is ready for shooting.

S Putting this input to positive, if FAST PUMP PRO PLUS is hot and armed, starts fog emission for the set time. In case of alarm, opening ARM input, the fog emission stops immediately, even if the time set wasn't reached.

VALIDATION INPUT

In order to validate this input, it's necessary to insert the jumper W4 **with the unit switched OFF**.

This input automatically generates AND function with input S.

If any input receives the shooting command, the generator doesn't emit fog if within 1 minute doesn't receive the command also from the second input.

P+ Output positive to give power to a validation sensor or a remote control receiver, max 300 mA.

P- Output negative to give power to a validation sensor or a remote control receiver, max 300 mA.

PV Validation input. It's possible to connect to this input a validation sensor with a contact normally closed connected to the terminal P-.

The PV input can be connected to external devices such as PIR or door sensors and behaves as an additional firing validation input. When the PV function is active, by closing the W4 jumper, the emission of fog will be possible **ONLY** if the SHOOT and PV commands have both been received, in any order, in a time interval not exceeding 60 seconds. After the shooting in these conditions both inputs will be inhibited for 2 minutes to avoid false activations.

OUTPUTS (all NPN Open Collector)

All Outputs are set in "Active Security", it means that the signals are normally **ACTIVATED** on outputs. If an event occurs on the unit, the signal will be **DEACTIVATED**.

E This output is DEACTIVATED when the bag is empty or the fogging machine emitted fog for at least 100" (Pump 250) or 60" (Pump 500). The signal is deactivated by a sensor that detects the absence of liquid just while shooting. The empty bag signal is deactivated only making the RESET (see paragraph 12). For this reason, if the bag is not inserted, or there is an empty bag inside, the unit will detect it just after a shot.

F This output is deactivated when there is a malfunction (such as batteries expired, fault of power supply or temperature control fault), which compromises the functioning of the device and which requires a technical action. Fault signal due to mains power supply absence is notified within 1 minute to avoid transient mains faults.

T This output is deactivate when the bag door is opened or nozzle obstructed.

C This output is deactivated when the fog unit is active and creating fog. Disarm the unit will immediately stop the fog flow.



Remember, it is necessary to connect all three outputs to an alarm central or an electronic panel that can see all those information in real time and take proper action.


Even if outputs are set in "active security", it is necessary to check carefully the reliability of connections and protect the cables to the control panel to avoid the risk of accidental damages.



The diagrams and examples below are intended only for a “better understanding” of the operation of the inputs / outputs. None of the diagrams below represents the “single scheme to perform” as, in respect of the reference standard EN 50131-8:2019, there are precise indications and only using all inputs and outputs on the PCB it is possible to abide by the standard.

- A** Example of connection of FAST PUMP PRO PLUS inputs with outputs of a standard alarm system
- B** Example of connection of FAST PUMP PRO PLUS inputs to an alarm with relay outputs
- C** Example of connection of FAST PUMP PRO PLUS inputs with outputs of an alarm with open collector outputs
- D** Example of connection of FAST PUMP PRO PLUS outputs to drive LEDs and / or relays
- E** Example of connection of FAST PUMP PRO PLUS outputs with inputs of an alarm normally opened
- F** Example of connection of FAST PUMP PRO PLUS outputs with balanced inputs of an antitheft
- G** Example of connection of FAST PUMP PRO PLUS outputs with antirobbery connection.
- H** Example of connection of FAST PUMP PRO PLUS outputs with relay board.


A - Example of connection of FAST PUMP PRO PLUS inputs with outputs of a standard alarm system

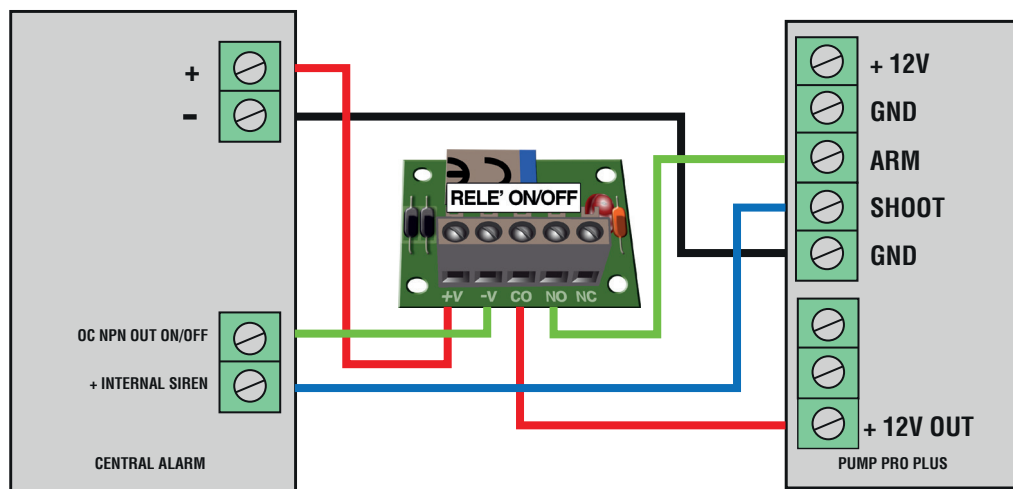

In the diagram above the control panel, as example, provides to UR Fog power supply between 11V and 14V DC 250 mA max. The ON/OFF output of this alarm is an Open Collector NPN opened when the system is off and it is stably closed to negative as long as the system turned on.


The alarm output of the alarm is normally open and becomes positive during the alarm time.

B - Example of connection of FAST PUMP PRO PLUS inputs to an alarm with relay outputs

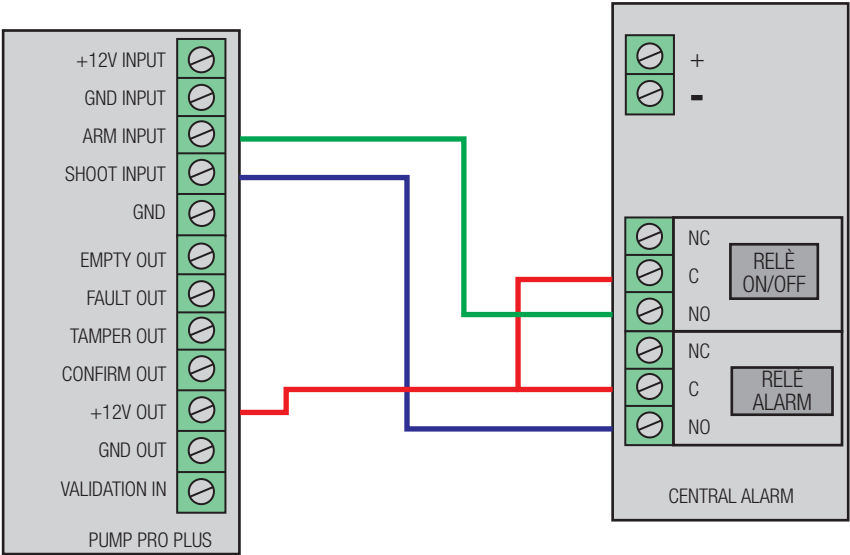


ON/OFF output of this alarm central is an open relay when the system is off and it is stably closed to positive as long as the system is turn on.

C - Example of connection of FAST PUMP PRO PLUS inputs with outputs of an alarm with open collector outputs

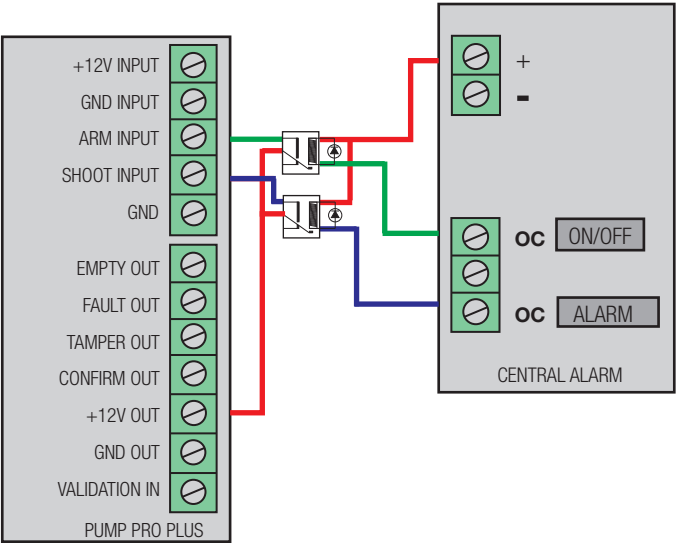


Compared to B diagram, this alarm central has only open collector outputs.
The simplest action to take is to use 2 relays to create a connection similar to the one shown in the previous diagram.

D - Example of connection of FAST PUMP PRO PLUS outputs to drive LEDs and/or relays

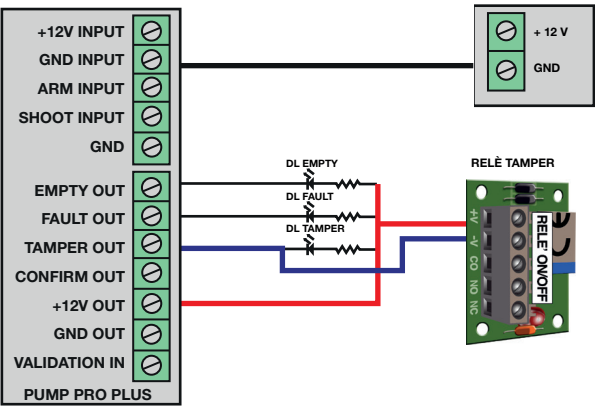

In case of an empty bag, the EMP LED (EMPTY) will switch on.
In case of a fault, the FLT LED (FAULT) will switch on.
By opening the cylinders door, besides the TPR (TAMPER) turning on, the relay will switch as well.
Max power applicable on the outputs is 100mA

E - Example of connection of FAST PUMP PRO PLUS outputs with inputs of an alarm normally opened

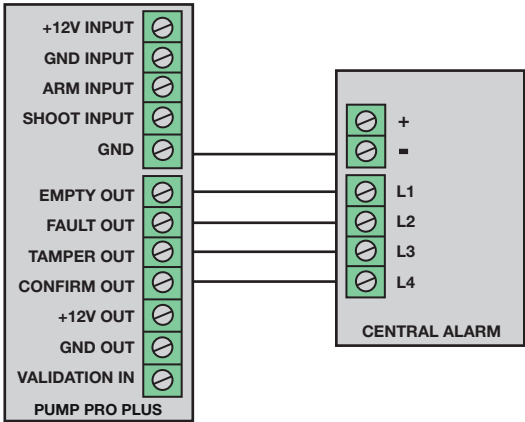


The UR Fog outputs are normally closed and connected with input zones of the alarm control panel normally opened.

F - Example of connection of FAST PUMP PRO PLUS outputs with balanced inputs of an antitheft

In this diagram, by putting a resistance with a value required by the alarm control panel used, in UR Fog terminal with not used outputs the central will see the correct resistance. After the deactivation of an output, a pull-down will occur causing the alarm in the corresponding zone.

Wiring diagram works with Alarm Systems (IHAS) using grounded (GND) Zone Inputs.
Ground (GND) reference between fogging system and IHAS is necessary. The EOL resistor must be defined by alarm provider.

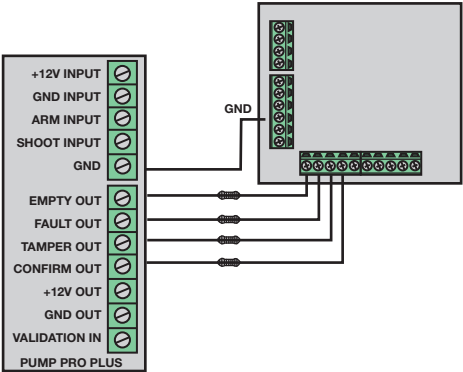

G -




N.B. Is recommend to use this function after a careful evaluation of the risks from a security consultant.

H -



10 SHOOTING TIME SETTING AND FOG FLOW DIRECTION

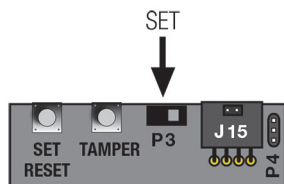

To set the shooting time, after opening the cover at the top of the PCB, facing the board you must move the jumper in left position P3 (closer to the buttons S1/S2). Then, holding down the button S1 "SET", 6 leds on the front will flash and each flash is equivalent to one second shooting time.

If you press the button again, the shooting time is not added to the one previously set, but will restart from zero.

N.B. Before opening the cover ensure that the control panel is set to "service", so that the opening of "anti-sabotage or tamper" circuit does not cause any shooting.

N.B. Shooting time can be set according to wished seconds, but to correctly activate the bag reserve in full security, it must be set minimum 4 seconds of shooting.

RECOMMENDED SHOOTING SECONDS ACCORDING TO THE VOLUME SPACE TO PROTECT (m³)

Fogging systems FAST PUMP PRO PLUS are able to produce fog for a maximum 30 seconds per single shot. The maximum quantity of 5,6 ml/s (FAST 250 PUMP PRO PLUS) and 11,3 ml/s (FAST 500 PUMP PRO PLUS) allows to fill an area of about 250 m³ and 500 m³. There might be cases in which, due to specific characteristic of the location, nozzle type, levels of temperature and air pressure, degree of the fog density and light in the target area, the shooting time can be increased or decreased. For example, above 5 m of height the shooting time must be integrated and above 7 m, every additional meter should be considered as double.

(HxLxP) x D x V x R x I

HxLxP----- Height x Width x Depth of the area to protect
D----- Density of the produced fog
V----- Temperature and air pressure
R----- Acceptable residue in case of saturation of V parameter
I----- Intensity of the surface light

The following tables indicate the suggested fog emission in relation to the number of seconds of shooting set in average condition of temperature, air pressure and humidity.

N.B. To correctly dimension the machines it is needed to verify that the saturation of the area occurs in faster time than the one supposed for the theft.

SHOOTING TABLE FAST 250 PUMP PRO PLUS

m³ to protect	Seconds of emission	m³ to protect	Seconds of emission	m³ to protect	Seconds of emission
8-15 (45*)	1	88-109 (327*)	11	168-200 (600*)	21
16-25 (75*)	2	96-119 (357*)	12	176-209 (627*)	22
23-35 (105*)	3	104-128 (384*)	13	184-218 (654*)	23
31-45 (135*)	4	112-137 (411*)	14	192-227 (681*)	24
36-55 (165*)	5	120-146 (438*)	15	200-236 (708*)	25
46-65 (195*)	6	127-155 (465*)	16	208-245 (735*)	26
56-75 (225*)	7	136-164 (492*)	17	215-254 (762*)	27
64-85 (255*)	8	144-173 (519*)	18	224-263 (789*)	28
72-95 (285*)	9	152-182 (546*)	19	232-272 (816*)	29
80-100 (300*)	10	160-191 (573*)	20	240-281 (843*)	30


* Industrial standard as from other manufacturers

SHOOTING TABLE FAST 500 PUMP PRO PLUS

m³ to protect	Seconds of emission	m³ to protect	Seconds of emission	m³ to protect	Seconds of emission
17-33 (99*)	1	187-203 (609*)	11	357-373 (1119*)	21
34-50 (150*)	2	204-220 (660*)	12	374-390 (1170*)	22
51-67 (201*)	3	221-237 (711*)	13	391-407 (1221*)	23
68-84 (252*)	4	238-254 (762*)	14	408-424 (1272*)	24
85-101 (303*)	5	255-271 (813*)	15	420-440 (1320*)	25
102-118 (354*)	6	272-288 (864*)	16	430-450 (1350*)	26
119-135 (405*)	7	289-305 (915*)	17	440-460 (1380*)	27
136-152 (456*)	8	306-322 (966*)	18	450-480 (1440*)	28
153-169 (507*)	9	323-339 (1017*)	19	460-490 (1470*)	29
170-186 (558*)	10	340-356 (1068*)	20	480-510 (1530*)	30

* Industrial standard as from other manufacturers

The value in the first column indicates the volume of the room to be protected, with respective seconds of emission reported in the second column. The value in m³ varies depending on the density to be obtained. Within the second column, the first value allows to get the maximum density recommended to ensure the absence of any residual, while with the second value you get minimum recommended visibility of according to the standard CENELEC, whereas a higher visibility would make the fog superfluous. In places where a little residual causes no problems, it is possible to increase the shooting time. Please note that the higher the fog released, the more the time required to recover visibility. High levels of fog, over recommended limits, can leave residual. Any residue usually goes away by itself within 24/48 hours, otherwise, being soluble in water, it is enough to use a wet cloth for cleaning. If you desire to obtain an average of 1 meter visibility after 60 seconds, as specified by the standard, as used as reference by all manufacturers of Fog generators, the number of shooting seconds must be reduced by half.

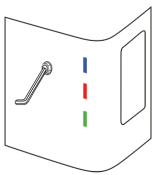

FOG FLOW DIRECTION

To ensure the right direction of the fog flow, it is recommended to insert a screwdriver of the diameter of the hole and, without forcing, orient the nozzle in the correct fog emission direction. This allows you to clearly see the direction and keep it in place while tightening. To screw and unscrew the nozzle you should use a pair of pliers in good condition to avoid damaging the plating. Do not overscrew the nozzle, it is sufficient that the teflon nozzle does not move. Do not direct the fog jet towards objects and walls less than 2 meters away or to the floor if it is installed at a height lower than 2.50 meters (we advise against the installation on the floor).




**WARNING! After the fog emission, and for a few minutes the nozzle is very hot
RISK OF BURNS IF TOUCHED by bare hands.**

11 NOZZLE TAMPER

The check of the obstruction of the nozzle is done with a little air flow, while a sensor check the pressure of the internal circuit. In case the sensor detect an increase of the internal pressure, means that there is an obstruction inside the nozzle. In the meantime, the output of Tamper will be deactivated, the buzzer will emit a sound with a fast frequency with the flash of the red LEDs. This condition of the alarm will continue until the system is disarmed and armed again. As the little compressor that introduces the air flow emits some vibrations, its activation occurs only in the following cases:


- When you press the button RESET for more than 5 seconds, will start a cycle of monitoring of 15 minutes, in order to simulate the obstruction and check the correct working.
- When the system is armed the cycle of monitoring starts. This cycle is the most important, because as the system was disarmed probably was easier to go near the machine and obstruct the nozzle. After 15 minutes, the compressor will stop automatically. If the system is disarmed and armed again, the cycle will start again for 15 minutes.
- After the emission of the fog, as normally the zone where the machine is installed is the last where the visibility is reduced, the generator remains vulnerable, giving the possibility to who generated the alarm to attempt the sabotage. For this reason, after the emission of the fog the compressor will be activated for 15 minutes.

12 INSTALLATION, EXCHANGE AND BAG RESET

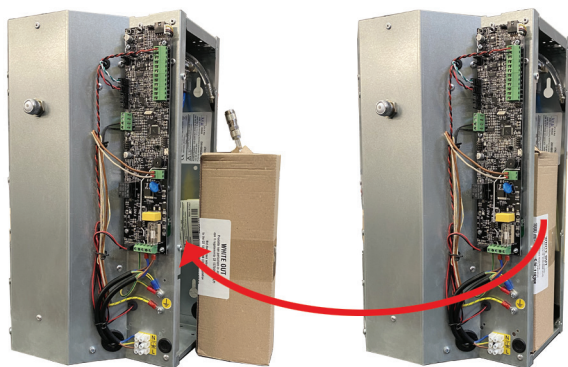

Insert the plastic bag in the compartment as shown in the picture

RESET

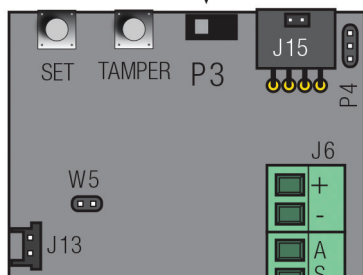


In order to make the reset the jumper P3 must be on the right position as you can see in the picture.

After that, insert a new bag until you hear the “click” of the metal plug (pictures at page 17) entering in its housing, then close the door.




N.B. When you close the door, the buzzer will make a sound to confirm the tamper switch is closed.

Attention: Before opening the side doors, make sure that the alarm control panel is in “service” mode, so that the opening of the “anti-sabotage or tamper” circuit does not cause any alarm.

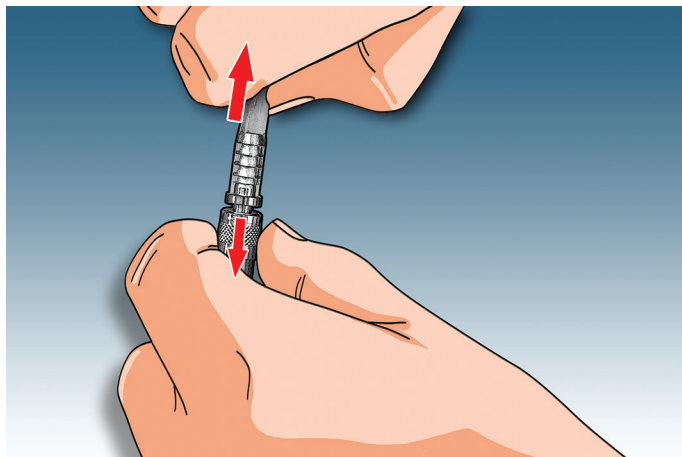

metal plug

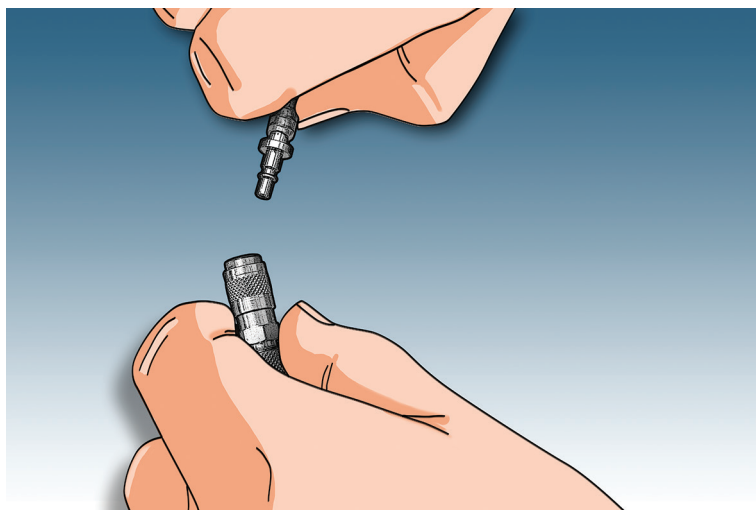

metal plug

13 FRONT LEDS MEANING

ARM
FAULT

BLUE LED

When on: the machine is armed and, if hot, it's ready to shoot.

When flashing: something is wrong (see paragraph 16 "DEFECTS AND POSSIBLE SOLUTIONS")

EMPTY
RESERVE

RED LED

When on: the bag is empty or it is in reserve.

When flashing: something is wrong (see paragraph 16 "DEFECTS AND POSSIBLE SOLUTIONS")

HEATING

GREEN LED

When on: the machine is hot and ready for the fog emission.

When flashing: the heating process is in progress. In this step the machine is heating but is not ready to shoot.



IF THE BLUE LED IS FLASHING, TOGETHER WITH A CONTINUOUS SOUND FROM THE BUZZER, A PROBLEM IS DETECTED. SEE PARAGRAPH 16

The symbol of empty bag, has the meaning of "RESERVE"

It means that, since the last bag reset the machine has shot at least 100" (PUMP 250) or 60" (PUMP 500).

UR Fog generators do not require special care, however, it is recommended the support of qualified and authorized personnel for periodic annual monitoring, taking into account the following:

- 1) Verify the good working condition of the power supply and backup battery
- 2) Verify the lock of the nozzle ferrule
- 3) Verify the entirety of the nozzle sphere
- 4) Check the air tightness of the circuit and the switch functioning
- 5) Annually verify the functioning of the fluid pump
- 6) Intervention report redaction and release of conformity declaration according to local rules

Check the efficiency of the power supply and of the battery

Verify that the tension of the no-load voltage power supply (disconnected battery) is 13,8 V. If tension is different, regulate it using the trimmer placed on the power supply. Verify the efficiency of the battery (it should not be hot and bloated); it is suggested to change it every two years due to the heavy and prolonged charge during the shot without mains power.

Entirety of the nozzle sphere

Verify that the nozzle hole is cylindric. The average duration of the nozzle sphere depends on the number and duration of the shooting, around 8L of fluid is the average life of the sphere.

Checking of the pneumatic circuit and the pressure control system

THE TEST SHOULD BE DONE JUST BY QUALIFIED PERSONNEL



Before starting the test of the pressure control it's necessary:

- to remove the bag
- to be sure that the nozzle is cold
- to be sure that the air pump is activated

The pneumatic seal test must be done within a few seconds when the air pump is turned on, as the nozzle temperature rises rapidly reaching temperatures that may cause serious burns.

The air coming out of the nozzle exceeds 200° C.

IT'S ADVISABLE TO USE GLOWES

- 1 – Obstruct the nozzle with soft and insulating material (for example an eraser).
- 2 – Keep the nozzle obstructed, press the button S1 with P3 set in RESET position and keep it pressed until you hear that the pump activation.
- 3 – Wait for the activation of the buzzer (Max 30")
- 4 – Remove the obstruction taking away your hand quickly to avoid to be in contact with the hot emission of air.
The buzzer must stop.
 - If after 30" you don't hear the buzzer, may be a loss inside the circuit; please contact the service center.
 - If after removing the obstruction the buzzer doesn't stop, it means that there is an obstruction; please contact the service center.

Annually verify the functioning of the pump

The test can be done by letting the fog generator shoot. If you do not want to shoot during the whole shooting time set, you can just disarm the machine and the shot will stop immediately.

15 RESET FROM FAULT CONDITION


This process is useful to discriminate false interpretations of faults caused by electrical shocks or serious problems on power supply from thermal loop problems.

- 1) Serious fault signal occurs with a first phase when the buzzer emits a continuous sound for 20 minutes and blue led flashes, the output FAULT immediately switch (if the generator is disconnected and connected again you can go directly at point 3)
- 2) After 20 minutes, the buzzer stops, while blue led goes on flashing, the FAULT output remains open.
This phase remains permanently, until the machine is completely disarmed.
- 3) When you connect again the machine, blue and red leds flash alternately and no sound is emitted.
This phase lasts up to 30 minutes, then, the output FAULT is reset and the generator start to work again.
If during this process the generator is disconnected, when you connect it again the time start again from the beginning and for 30 minutes.

If at the end of this process, the generator start to work again regularly is not necessary any further operation.

If occurs again the fault condition within the following 20 minutes, it's necessary a check from the assistance center, or to send the machine back to the factory.

DEFECT FOUND	POSSIBLE CAUSE	POSSIBLE SOLUTION
When you arm the machine you hear an internal buzz, like a motor	The compressor is checking that there are no obstructions in the circuit of fog emission	When the machine is armed, for 15 minutes the compressor will monitor the nozzle. After this time it will deactivate automatically: if the fogging system is disarmed, the compressor will go on with it reaches 15 minutes. If the machine is disarmed and then armed again, the count will start again from zero
When you arm the fogging system, a little fog flow goes out from the nozzle even if the machine has never shot before	During testing phase in the factory, we also test the quality of fog in all produced systems, a little quantity of the fog liquid remains in the ducts	This emission occurs just at first activation, it will decrease visibly with any activation, until disappearing completely. After an eventual disassembly and reinstallation or after the transport of the machine, with the first activations a little flow of fog can occur again
The 3 frontal LED are flashing and the buzzer emits 1 beep for minute	The tension on +12 V input is too low or too high	Check the external power supply
The buzzer emits 2 beep for minute	Low battery shot still possible	Verify/replace battery - See paragraph MAINTENANCE
The buzzer emits 3 beep for minute	Low battery shot still possible	Verify/replace battery - See paragraph MAINTENANCE
The buzzer emits 10 continuous beep for minute	Battery not present	Insert battery
	Connector not inserted correctly	Remove and reinsert the connector
	Verify that jumper W5 is inserted	Insert jumper W5
The machine is armed (BLUE LED ON) but doesn't shoot	The front RED LED is on	Bag reset has not been made Reset as described in paragraph 12
		Bag is in reserve or empty. Change the bag as described in paragraph 12
	The front GREEN LED flashes	The heat exchanger has not yet reached the minimum temperature of shooting, wait for the green led to stop flashing. Standard heating time: 60 min. (250 model)
	Wiring error	Verify that the alarm, once activated has tension on connectors of at least 12 V between GND(5) + SHOOT(4)

DEFECT FOUND	POSSIBLE CAUSE	POSSIBLE SOLUTION
BLUE LED is flashing	Overvoltage power line (110/220 V)	Try to reset. See paragraph 15 In case of unsuccessful restore the PCB can be damaged, contact the assistance service.
The buzzer emits a continuous sound	Overtemperature of the PCB	Check there is a sufficient ventilation around the machine. See paragraph 15 To reset see paragraph 15
BLUE and RED LEDS are flashing alternately	Disturbance/ interference or potential differences between devices	In the case of strong interference (lightning) can occur a thermocouple reading error, make a reset. See paragraph 15. In case of unsuccessful restore can be occurred a potential difference or a fault.
		In large size plants or with more than on fogging system connected with the same central, in rare situations, it may occur that there are potential differences between the equipments and it could be necessary to uncouple them.
Impossible to arm the machine BLUE LED doesn't switch on	Error in the thermal loop	Possible fault of: thermocouple, resistance or fuse cable. Don't try to repair. Contact the assistance service center.
	Wiring error	Check on the terminal with a tester that when the alarm system is tuned on there is a minimum voltage of 11 V between - GND (5) + ARM (3).
When you press the reset button you don't hear the sound of the buzzer, the frontal LED are flashing but the RED LED does not reset	The Jumper P3 is in the "SET" position	 <p>Warning in this case shooting time is reset to zero Bag reset - Paragraph 12 Shooting time setting - Paragraph 10</p>
Setting the shooting time, the buzzer does not sound and the LEDs do not flash	The jumper P3 stands in the "RESET" position	See the setting mode of the shooting time at paragraph 10

The warranty of UR Fog is two years and is handled directly from the dealer or authorized installer, so please contact your supplier to take advantage of warranty with the copy of the purchase document that contains the serial number of the machine. Not included in the warranty: moving parts and/or damages depending on the incorrect use unless it is found a manufacturing defect in origin. Liquid and bags are not covered by warranty.



BY BREAKING THE SECURITY LABELS AND THE OPENING OF THE MACHINE
YOU WILL ACCEPT WHAT IS WRITTEN ON THIS MANUAL AND ON
THE WEB SITE: **www.urfog.com**



We recommend to throw away the batteries in the appropriate waste containers for recycling. Heavy metals contained in them are recyclable.



UR Fog srl: Via Toscana n. 38 - 10099 San Mauro Torinese - Italy
Phone 011/01.33.037 - Fax 011/01.33.005
support@urfog.com

Legal office: Via Giacinto Collegno 11 - 10143 - Torino - Italy

RESELLER/INSTALLER STAMP
(company to contact for the warranty)

Serial number _____

Date of installation _____

Signature of installer _____

DATE	BATTERY EXCHANGE		BAG EXCHANGE		SIGNATURE
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	
	YES	NO	n.	NO	



It is mandatory to fill out this table in accordance with the law



Certificate of Conformity

Product Certification Scheme 1B

Certificate No. 30422-01-20-INT Rev.1

This certificate applies to the product

Security fog devices

with name and/or type designation

FAST PUMP 250 Pro Plus

FAST PUMP 500 Pro Plus

Placed on the market by

UR FOG S.r.l.

Via collegno 11, 10143 Torino, Italy

This certificate attests that all provisions concerning the assessment and the performance described in the standard

EN 50131-8:2019

are applied and that the products fulfils all the prescribed requirements

This Certificate is valid until 2024-04-03

Høvik, Norway 2020-04-03

For Applica Test & Certification AS

A handwritten signature in blue ink, appearing to read 'Jan Rune Pedersen'.

Jan Rune Pedersen, Certification Manager



PROD 022



UR Fog S.r.l. Via Toscana 38 - 10099 San Mauro T.se (Torino) - Italy